


## Top Cowl Unlatching – 1989-1991 135 thru 200

**MARINER AND MERCURY**  
**135-200**  
**S/N 0C100861-0D038616**

Outboard operation on extremely rough water may cause the front handle/latch to deform and not retain the top cowl as designed. To prevent the top cowl from unlatching, install Handle/Latch Kit P/N 813076A-2. The kit contains an improved (straight) front handle/latch P/N 813076--3, a special spacer for the roller assembly, fasteners and installation instructions. Also refer to service bulletin 90-4 for rear cowl latch changes for early models.

### COMPONENTS IN KIT:

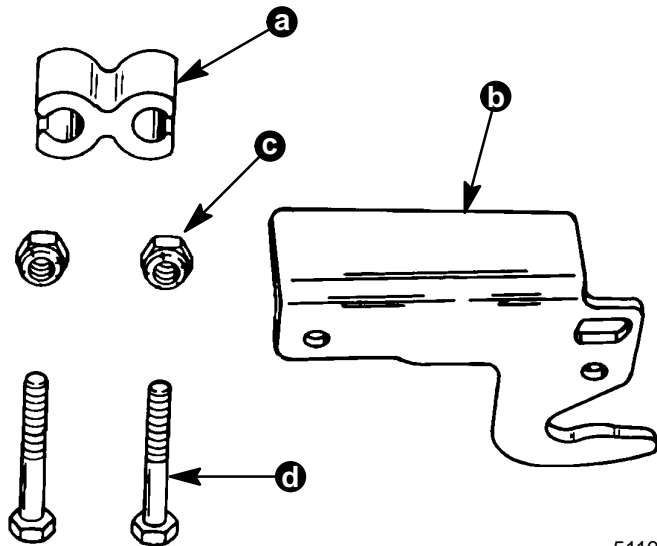

51192

- a - Special Spacer
- b - Handle/Latch P/N 813076--3
- c - Lock Nut (2)
- d - Screw (2)

### Handle/Latch Kit P/N 813076A-2

The improved front handle/latch P/N 813076--3 is factory installed on 135-200 models starting with serial number 0D038617.

### WARRANTY:

If a failure occurs within twelve (12) months from the date of original sale, the normal warranty applies.

Complete warranty claim listing:

Outboard serial number.

Qty. 1 813076A-2 Handle/Latch Kit

One half (0.5) hour labor.

Warranty labor rate code NJC.

Failure code 905 24.

US & Canada – Tag and hold parts for 60 days after credit is received.

International – Hold for inspection/disposal by a Marine Power International technical representative.