

Circulate to: Sales Manager Accounting Service Manager Technician Parts Manager

Flo-Torq SSR HD Propeller Hub Application Information

Models Affected

Engine	Serial Number Range
Verado 350/400R	2B244272 and below

Scope

Worldwide

Situation

Engines listed above, if equipped with a Flo-Torq SSR HD propeller hub kit (P/N 8M0101601) may experience the engine remaining in gear when the remote control levers are returned to the neutral position. The engines will shift into the next gear position when the remote control lever is moved to the next gear position.

Correction

The engine calibration has changed to prevent this from occurring. Engine models listed above with a starting serial number of 2B244273 are equipped with the new calibration.

Use the CDS G3 version 1.7.3 to reflash the engine PCM for the engines listed in **Models Affected**, if equipped with a Flo-Torq SSR HD propeller hub.

Warranty

If the engine is within the warranty period, submit a warranty claim through your normal warranty processing channel.

- Engine serial number
- Labor: 0.3 hours per module
- Flat rate code: SB03
- Part code: 731
- Fail code: 00

Outside the United States and Canada: follow the instructions issued by your local office or distributor.

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.