

TO: SERVICE MANAGER MECHANICS
PARTS MANAGER

No. 92-13

A. LEAKAGE BETWEEN EXHAUST PIPE AND GIMBAL HOUSING ASSEMBLY

Models


All stern drive models using **Through Prop Exhaust**. This includes all serial numbers.

Problem

Paint build-up on mating surface of the exhaust pipe can prevent proper sealing of the exhaust pipe to the gimbal housing assembly. A poor seal may result in water and / or exhaust leaking into the engine compartment or bilge of the boat.

Correction

Check mating surface of the exhaust pipe (shown below) for paint runs ect. If an irregular surface is found due to paint build-up, Any paint runs on the flange surface at the exhaust pipe should be sanded off so the flange is smooth and will seal properly.

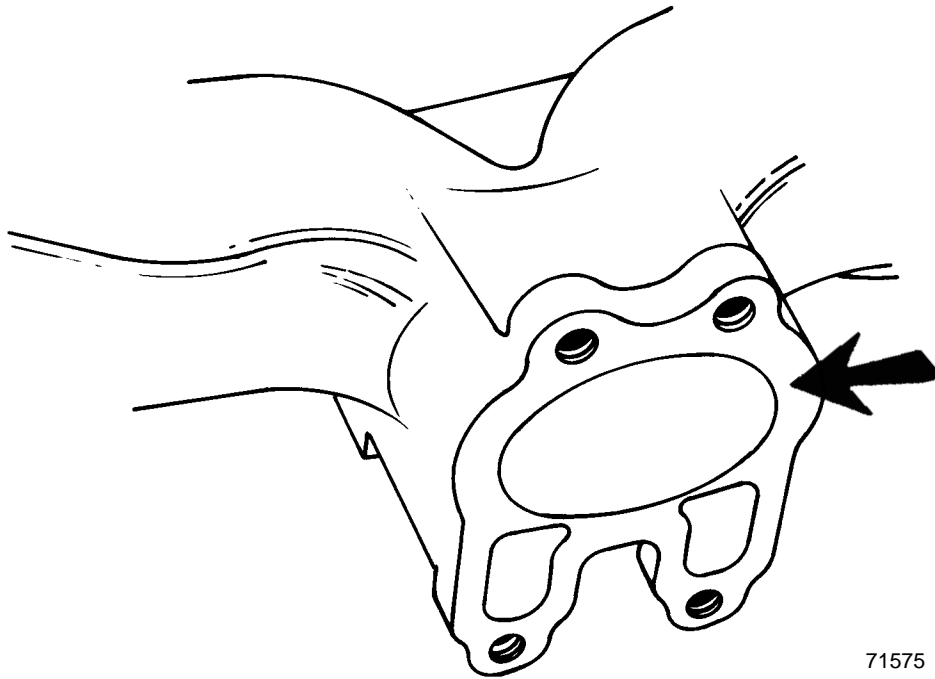

71575