

Circulate to: Sales Manager Accounting Service Manager Technician Parts Manager

Required Axius Power Steering Fluid

Models Affected

All Axius MerCruiser Models

Situation

MerCruiser has received reports that in isolated cases, some Axius power steering systems have been contaminated by the use of incorrect fluid type and external debris.

Correction

Avoid contamination from incorrect fluid type and external debris.

- Minimize the time that the Dexron III is exposed to the environment.
- Clean the power steering reservoir cap with a clean cloth before removing it, to minimize the possibility of debris entering the system. Replace the cap immediately after adding fluid.
- Clean all connections with a clean cloth before removing the hose or part. Use shipping caps to keep the fluid clean during service.
- Use only Dexron III automatic transmission fluid in the Axius power steering system.

Axius Models	Capacity	Fluid Type	Part Number
Steering system	2.9L (3.1Qt)	Dexron III automatic transmission fluid	Obtain locally

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.