

2.5 EXHAUST ADAPTER AND DIFFUSER

Hi-Performance 2.5 carbureted and EFI outboards, serial numbers D180999 and below, may experience exhaust tuner breakage. An improved adapter, diffuser, and attaching hardware are now available.

If an exhaust tuner does break off, it will fall into the bottom of the driveshaft housing, causing an exhaust restriction and loss of power. **This condition can cause powerhead failure.**

If an early tuner breaks, it should be replaced with the following part:

Mercury Part No. 817716A 3
Mariner Part No. 817716A 4