

WARRANTY INFORMATION SERVICE INFORMATION
 PARTS INFORMATION

Bulletin No. 2002-08

Circulate to: Sales Manager Accounting Service Manager Technician Parts Manager

16 Mount/Little Gator Slide Bar Replacement

Models Affected

All 2001-2002 MST91642, Little Gator 16 Mounts

Situation

Under certain circumstances the locking pins may loosen or fall out of the bow arm.

Correction

If the locking pins become loose and/or fall out of the bow arm, replace the lock slide assembly inside the bow arm. The new lock slide assembly will have a plastic lock slide riveted to each end of the lock bar. Replace the lock pins if missing.

Repair Instructions:

Step 1: Remove the two clutch knobs and bolts and separate the top channel from the clutch channel.

Step 2: Remove both lock pins from the bow arm.

Step 3: Loosen both #10 set screws from the bow arm pivot pin and remove the pin.

Step 4: Remove the lock slides, untie the rope, remove the spring and install the new lock slide.


Step 5: Retie the rope and install the spring on the lock slide and reinstall it into the bow arm.

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MOTORGUIDE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by MotorGuide and may not be distributed or copied, digitally or otherwise, without the prior written consent of MotorGuide.

Step 6: Install the pivot pin through the channel, bow arm and lock slide spring and tighten set screws.

Step 7: Install the lock pins. Reassemble the clutch channel and the clutch knobs.

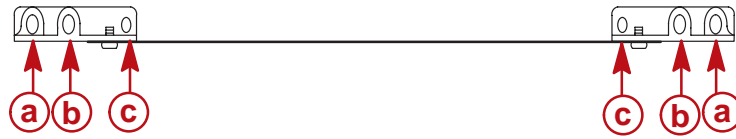

- a** - Rope
- b** - Lock pins
- c** - Spring lock

Parts Required

| | | |
|--------|--------------|---------------------|
| Qty. 1 | MNK313052 | Lock Slide Assembly |
| Qty. 2 | 17-MAK10603C | Lock Pin |

Warranty

Repairs will be covered one year from the date of this bulletin. Please note the month and year located at the lower left corner of the front page of this bulletin.

Complete a warranty claim providing:

- Model number and serial number of the trolling motor
- Proof of purchase of the Little Gator 16 Mount
- Five tenths (0.5) hour labor
- Warranty Flat Rate Code: SB05
- Part Code: 851
- Failure Code: 00

US and Canada: Complete/process claim via MercNET or a warranty claim form.

Fax: 1-920-929-5893

Mail to: Mercury Marine

Attn: Warranty Department

P.O. Box 1939

Fond du Lac, WI 54936

International: Follow instructions issued by the Marine Power International office or by your distributor.

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MOTORGUIDE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by MotorGuide and may not be distributed or copied, digitally or otherwise, without the prior written consent of MotorGuide.