

Warranty Information
 Parts Information

Service Information

Bulletin No. 2003-08

Circulate to: Sales Manager Accounting Service Manager Technician Parts Manager


Electric Oil Pump No Longer Available (NLA)

Models Affected

Mercury/Mariner	Serial Number or Year
OptiMax Outboard 135 thru 225 HP	S/N 0G590000 Thru 0G960499 1998 and 1999 Models

Situation

The original oil pump for the above listed models is No Longer Available (NLA). New oil pump kits using the new style oil pump will replace the original pump. The new kits replace the old pump, gasket, and bracket assembly. The bracket assembly contains the oil hose fittings which are different between the 2.5 and 3.0 liter engines. Because the fittings are different, 2 different oil pump kits are required. The new oil pump kits contain the new oil pump, wire harness adapter to convert the 4 pin connector to a 2 pin connector, and installation instructions.

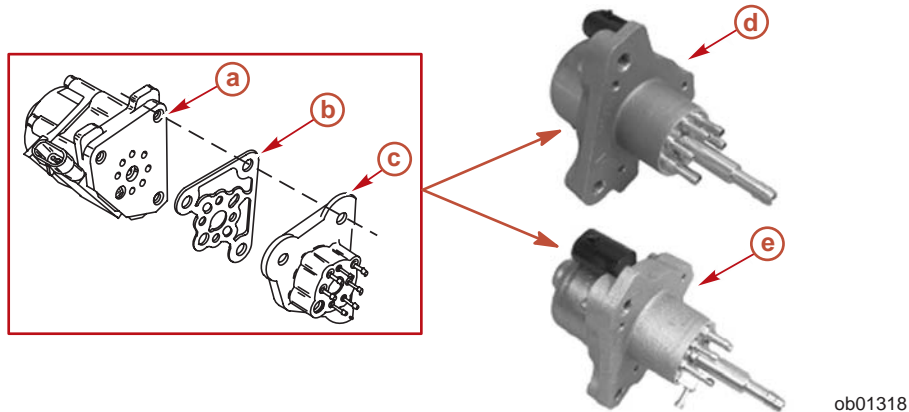

a - Oil pump (old style)
b - Gasket
c - Bracket

d - New oil pump 2.5 liter
e - New oil pump 3.0 liter

Description	Part Number
Oil pump kit 3.0 Liter 200/225 HP	859373A01
Oil pump kit 2.5 Liter 135/150 HP	859372A01

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.