

Circulate to: Sales Manager Accounting Service Manager Technician Parts Manager


Direct Injector Compression Washers

Models Affected

All Mercury Racing 3.0 Liter DFI (OptiMax) Products

Situation

Beginning in 2006 model year, all Mercury Racing 3.0 liter DFI products switched to rubber direct injector compression washers.

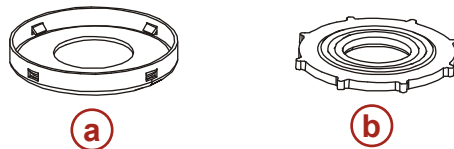

16113

- a** - Standard compression washer
- b** - New rubber compression washer

Correction

This update is not required on past models; however, if servicing direct injectors or compression washers on a Mercury Racing 3.0 liter DFI product, Mercury Racing recommends replacing all existing compression washers with six new rubber washers.

IMPORTANT: When replacing compression washers, replace all six washers.

The standard (steel) washer is still a valid part for other products, so the part number does not supersede to that of the rubber washer. Order the Direct Injector Compression Washer Kit (859404A06), which includes six new washers and installation instructions.

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.