

Circulate to: Sales Manager Accounting Service Manager Technician Parts Manager

8/9.9 HP FourStroke Ignition Coil Test Specifications

Models Affected

Models Covered	Part Number
8/9.9 FourStroke 9.9 BigFoot FourStroke Service Manual	90-892248R01


Situation

Mercury Marine has updated troubleshooting specifications for the ignition coil in the above listed service manual. Use the revised specifications provided when troubleshooting the ignition coil on the above mentioned models.

Locate the appropriate page in your service manual and insert a copy of these revised ignition coil testing specifications. These specifications will be revised on the next release of the service manual.

Correction

Ignition Coil Primary Windings

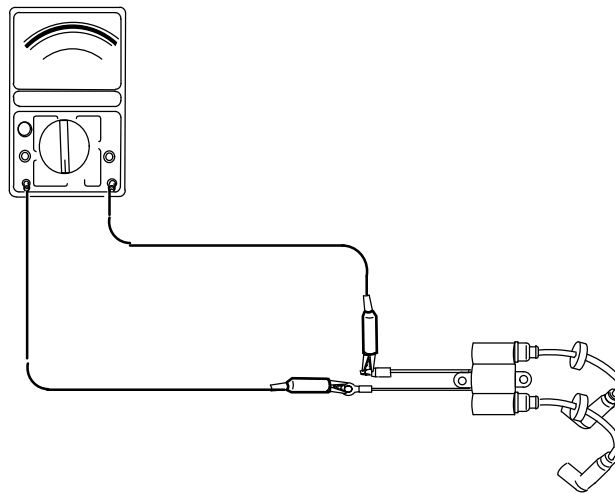

2882


Description	Part Number
DVA/Multimeter kit	91-99750A 1
DMT 2004 digital multimeter	91-89264A01

Meter Test Leads		Meter Scale	Reading (Ω)
Red	Black		
Orange	Black	R x 1	0.2-0.8

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.

Ignition Coil (Secondary)

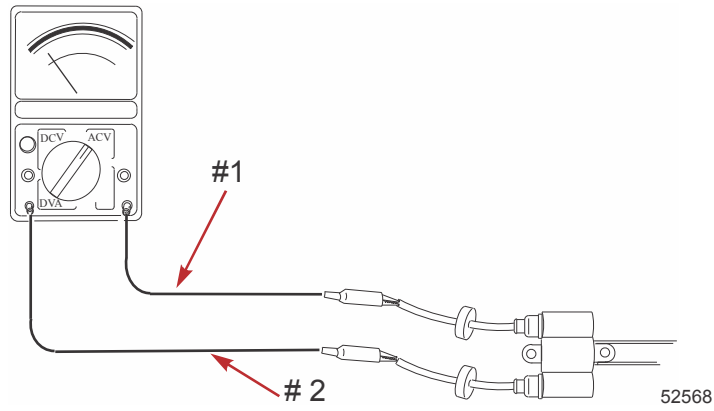

Meter Test Leads		Meter Scale	Reading (Ω)
Red	Black		
#1 spark plug lead	#2 spark plug lead	R x 1K	5-15

THE INFORMATION IN THIS DOCUMENT IS CONFIDENTIAL AND PROTECTED BY COPYRIGHT AND IS THE PROPERTY OF MERCURY MARINE.

This document is provided for the sole and exclusive use of the original recipient as prescribed by Mercury Marine and may not be distributed or copied, digitally or otherwise, without the prior written consent of Mercury Marine.