


Digital ECU Tester Harness Inspection

Part Affected

Digital Diagnostic Terminal adapter harness
 84-822560A8



Problem


The harness may not be assembled correctly. Digital ECU boxes used on Hi-Performance 2.0 Litre, 2.5 EFI's and service replacement digital boxes for 2.4 EFI's will not be able to communicate with the DDT test unit.

Test Procedure

NOTE: If the harness has been used and communication existed between the ECU and DDT tester, the harness is good and requires no further testing.

If the harness has not been used or when used, there was a problem with getting any data, check the continuity between the following terminals on the harness.

TESTER END (four pin female)	ECU END (five pin male)
1	D
2	B
3	A (also red connector)
4	C
	E Vacant

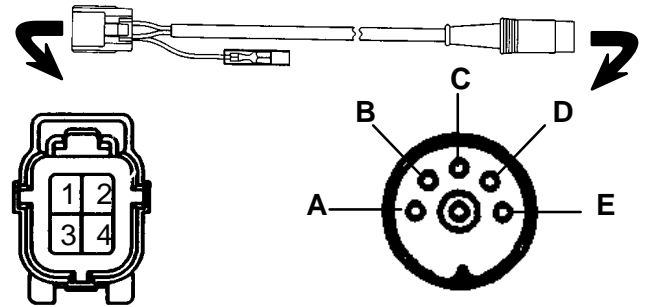

Correction

If continuity is not correct, replace the harness. Return the old harness with a warranty claim and reorder the replacement harness using the same part number.